

1/4 - 14 x 7/8" STITCH TEK 2 1/2" O/C


FILL VOIDS AT HIGH-RIB OVERLAP COMPLETELY WITH SEALANT (NOT BY IMP SUPPLIER)

NOTE: BUTYL SEALANT AND BUTYL TAPE TO RUN ACROSS FULL WIDTH OF PANELS; NOT SHOWN AT HIGH RIBS FOR CLARITY.

(1) ROW OF 1" x 3/16" BUTYL TAPE SEALANT

SUPPORT ANGLE AND FASTENERS BY OTHERS (NOT BY IMP SUPPLIER)

"SW-01" SADDLE WASHER W/ 1/4 - 14 x ___ TEK 3 FASTENER W/ WASHER SPACED ___ O/C (PILOT HOLE RECOMMENDED)

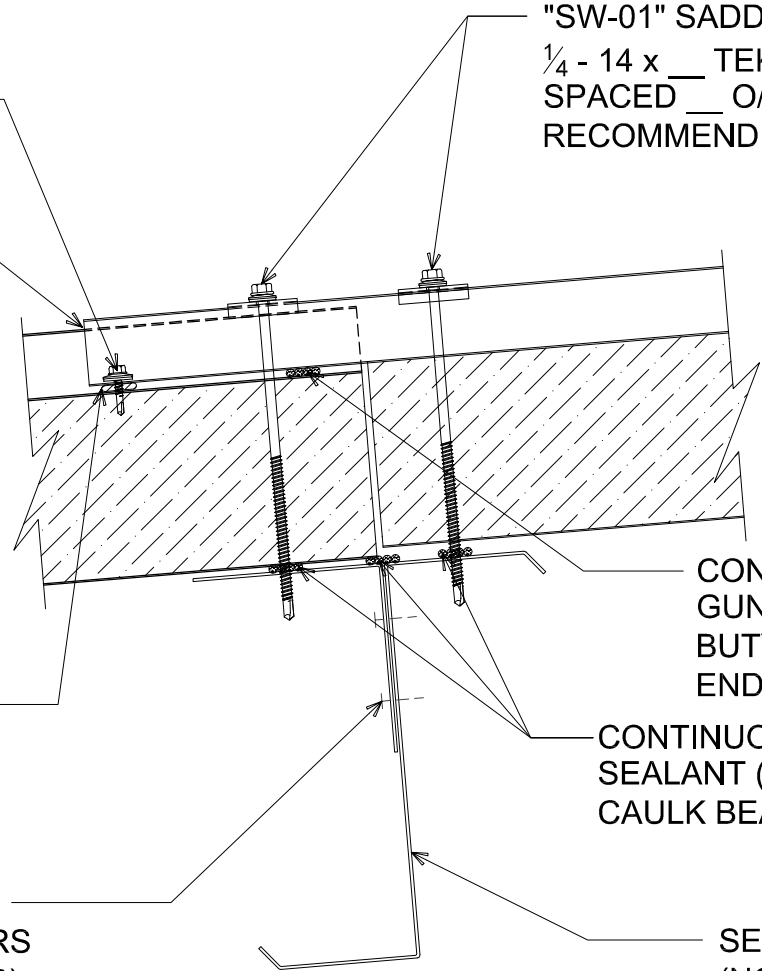

CONTINUOUS 1/2" Ø BEAD OF GUN-GRADE NON-SKINNING BUTYL SEALANT AT PANEL ENDLAP

CONTINUOUS 1/2" Ø BEAD OF BUTYL SEALANT (CONNECT ENDS OF CAULK BEADS TO CLOSE AND BOX)

SECONDARY FRAMING (NOT BY IMP SUPPLIER)

HR ROOF PANEL ENDLAP

(SECTION VIEW)

NOTE: REFER TO SECTION 13.6 ON THE HR3 & HR5 INSULATED ROOF PANELS GENERAL INSTALLATION GUIDE FOR ADDITIONAL INFORMATION.

DETAIL: ENDLAP

929 ALDRIDGE ROAD
VACAVILLE, CA 95688
TEL: (707) 359-2280
FAX: (707) 359-2286
WWW.AWIPANELS.COM



APPLICATION: HR ROOF, COMMERCIAL & INDUSTRIAL, COLD-STORAGE, COLD-CLIMATE
AWIP DETAIL NUMBER: HRR-CJCSCC-EL-001

DATE: 03/21/19
DRAWN BY: MMF
SHEET: 1 OF 1