

HR_ INSIDE CLOSURE STRIP
W/ $\frac{3}{4}$ " x $\frac{3}{32}$ " BUTYL TAPE
SEALANT AT TOP & BOTTOM

3"

FIELD-FILL W/ COMPRESSIBLE
INSULATION (NOT BY IMP SUPPLIER)

**NOTE: FIELD-REMOVE FOAM
& LINER AT CUTBACK.**

$\frac{1}{4}$ -14 x 0.88" HWH
DP1 6" O/C

"LE-__" LOW EAVE TRIM

POP RIVETS 12" O/C

"WC-01" PANEL CLIP W/
() $\frac{1}{4}$ - 14 x _ HWH DP3 W/O
WASHER AT PANEL JOINT

"SW-01" SADDLE WASHER W/
 $\frac{1}{4}$ - 14 x _ HWH DP3 W/
WASHER SPACED _ O/C
(PILOT HOLE RECOMMENDED)

BUTYL TAPE SEALANT


BUTYL TAPE SEALANT (MARRY
TO VERTICAL SEALANT)

EAVE STRUT
(NOT BY IMP SUPPLIER)

BUTYL SEALANT AT
VERTICAL JOINT

GUTTERLESS EAVE

(SECTION VIEW)

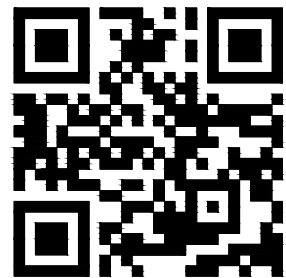

DETAIL: GUTTERLESS EAVE	DATE: 11/02/23	SHEET: 1 OF 1
	DRAWN BY: MMF	
APPLICATION: HR ROOF, COMMERCIAL & INDUSTRIAL AWIP DETAIL NUMBER: HRR-ACL-GE-001		
929 ALDRIDGE ROAD VACAVILLE, CA 95688 TEL: (707) 359-2280 FAX: (707) 359-2286 WWW.AWIPANELS.COM		